

Work Order ID 78496

78496

Page 1

January-10-12 1:03:35 PM

Item ID: D205-634-141 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Replacement Skidtube
 Start Date: 10/01/2012 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 16/01/2012 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: M.L.S Date: 12/01/10 Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
IIN D205-634	<u>8 E</u>

100	DOCUMENT CONTROL	0.00							
100									
DC	Memo	0.00							
Document Control	Photocopy D205-634 bluefile & type labels per PPP D205-634-141 CHG001								

N/A [Signature]

110	BENDING MACHINE - SKIDTUBES	0.00							
110									
CNC Bend 1	Memo	0.00							
CNC Delta 100 Bender	1-Bend as per program D2580.C on CNC Bender and Folio 16								
	2-Cut tubes as per Dwg. D2580								
	3- scribe batch# in aft end of tube								

ET 12-01-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 78496

78496

Page 2

January-10-12 1:03:35 PM

Item ID: D205-634-141 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Replacement Skidtube
 Start Date: 10/01/2012 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 16/01/2012 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120		0.00							
120									
Skidtubes	Memo	0.00							
Skidtubes	1- Deburr ends and remove bending marks								
	2- Prepare tube for welding as per QSI 004								
130	QC5- Inspect part completeness to step on W/O	0.00							
130									
QC	Memo	0.00							
Quality Control									

> DP 12-1-10

1 8 BE12-01-11

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 78496

78496

Page 4

January-10-12 1:03:35 PM

Item ID: D205-634-141

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Replacement Skidtube

Stop ***NS2***

Start Date: 10/01/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 16/01/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							
160									
QC	Memo	0.00							
Quality Control									
170	Pressure Wash per QSI005 4.3	0.00							
170									
HandFinish	Memo	0.00							
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.								
180	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
180									
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 7:30 OVEN TEMPERATURE: 320°F FINISH TIME: 8:00								

M119480

1 12-1-11
1X0 m/l 12/01/12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 78496

78496

Page 5

January-10-12 1:03:35 PM

Item ID: D205-634-141

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube

Start Date: 10/01/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 16/01/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	QC3- Inspect Part Finish	0.00							
190									
QC	Memo	0.00							
Quality Control									
200		0.00							
200									
HandFinish	Memo	0.00							
Hand Finishing	1-Install wearplates as per Dwg. D2580.								
	2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580								
	3-Inspect for foreign object per QSI 024								
	4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive								
	A/R Sikaflex-291 <u>119543</u>								
	Sikaflex expire date: <u>12-8</u>								
	5-Wing Walk as per Dwg D2580 and QSI 005 4.4								
	Batch: <u>119094</u>								

1 BL 12-1-12

1 BL 12-1-12

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 78496

78496

Page 6

January-10-12 1:03:35 PM

Item ID: D205-634-141 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Replacement Skidtube
 Start Date: 10/01/2012 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 16/01/2012 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210 *210* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024	0.00 0.00							<i>8/10 →</i>
220 *220* Packaging Packaging Packaging	Packaging Memo Identify and pack for shipping as per PPPD205-634-141 Location: PPP Rev: <i>PPM4160</i>	0.00 0.00							<i>44/01/12</i>
230 *230* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.00							<i>12/1/12</i> <i>MF</i> <i>12-01-12</i>

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Dart Aerospace Ltd

W/O: 78496		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D205-634-141 PAR #: Fault Category: Design NCR: Yes No DQA: AW/2 Date: 12/1/17
 Resolution: Re work Disposition: Re work QA: N/C Closed: OK Date: 12/1/17

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
12/01/11	# 210	During assembly found that the D4406-043 wear plate doesn't fit! has large gaps underneath to mating surface of skid tube.	MP 12/01/11	→ Fill in two aft holes with weld as per as2005 A/12 M114509	EL 12-1-12	S 12/01/12 S 12/01/12 S 12/01/12	MP 12/01/14	S 12/01/14
		R.C. improper design		locat to Re-drill hole for better fit.	EL 12-1-12			
				ReApply Locker gaurds M119947 when it has been removed	MP 12-01-12			
				4406-043 plate B78117	EL 12-1-12			

NOTE: Date & initial all entries

Picklist Print

January-10-12 1:03:38 PM

Page 1

Work Order ID: 78496

78496

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube

Start Date: 10/01/2012

Required Date: 16/01/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA 11.09.14 new issue EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN4-45A		Purchased	No				Each	120.0000		8			
AN4-45A													
Bolt													

Location	Loc Qty	Loc Code
----------	---------	----------

ST350A	120	
118926✓	120	

D2570		Manufactured	No				Each	187.0000		16			
D2570													
Bushing													

Location	Loc Qty	Loc Code
----------	---------	----------

ST011	187	
66933	1	
67759	6	
72122	1	
72960	41	
77421	41	
77422✓	97	

D4202-1		Manufactured	No				Each	0.0000		20			
D4202-1													
Spacer													

D4406-041		Manufactured	No				Each	3.0000		1			
D4406-041													
Fwd Wearplate Assembly													

Location	Loc Qty	Loc Code
----------	---------	----------

FP002	3	
74147	2	
74150	1	

4

BR 10-1-12

BR 12-1-12

D2579

BE 12-01-11

B78371 * 24

BR 12-1-12

1

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

January-10-12 1:03:38 PM

Work Order ID: 78496

78496

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube

Start Date: 10/01/2012

Required Date: 16/01/2012

Start Qty: 1.00

Required Qty: 1.00

D4406-043

Manufactured No

Each 3.0000

1

D4406-043

Aft Wearplate Assembly

**

BL 12-1-12

Location

Loc Qty

Loc Code

FP001

3

74148 ✓

2

74149

1

1.

MS21042-4

Purchased No

Each 1,260.000

8

MS21042-4

USE MS21042L4

**

BL 12-1-12.

Location

Loc Qty

Loc Code

ST299

1260

100743

9

119124

1000

5389

78

5461

3

6844

19

7690

24

8182

115

9063

8

9229

4

8

D2580-1

Manufactured No

Each 5.0000

1

D2580-1

205 Skidtube bent detail

**

BT 12-01-11

Location

Loc Qty

Loc Code

LG

5

76570

2

77679

2

77680

1

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

January-10-12 1:03:39 PM

Work Order ID: 78496

78496

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube

Start Date: 10/01/2012

Required Date: 16/01/2012

Start Qty: 1.00

Required Qty: 1.00

D2576-3 Manufactured No

Each 87.0000 1

D2576-3

**

BE 12-01-11

Step (maching detail)

Location

Loc Qty

Loc Code

LG

87

70883

37

74136

50

D2855 Manufactured No

Each 35.0000 1

D2855

**

BR 12-1-12

Cap

Location

Loc Qty

Loc Code

FP002

35

65519

2

73347

33

AN3-5A Purchased No

Each 766.0000 2

AN3-5A

**

BR 12-1-12

Bolt

Location

Loc Qty

Loc Code

ST350

766

115371

46

117423

220

118626

300

119355

200

AN960JD10L *NAS1149D0332J* Purchased No

Each 0.0000 2

***AN960JD10L ***

**

BR 12-1-12

Washer

119042

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR: Yes No** **DQA:** _____ **Date:** _____
Resolution: _____ **Disposition:** _____ **QA: N/C Closed:** _____ **Date:** _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 4

January-10-12 1:03:39 PM

Work Order ID: 78496

78496

Parent Item: D205-634-141

D205-634-141

Parent Item Name: Replacement Skidtube

Start Date: 10/01/2012

Required Date: 16/01/2012

Start Qty: 1.00

Required Qty: 1.00

D2594-3 Manufactured No

Each 352.0000 8

D2594-3

O-Ring, 205 Skidtube

**

OR 12-1-12

Location

Loc Qty

Loc Code

FP001

352

65518

41

73490 ✓

311

D2594-1 Manufactured No

Each 368.0000 8

D2594-1

Plug, 205 Skidtube

**

BR 12-1-12

Location

Loc Qty

Loc Code

FP001

368

73401

30

74442

34

74869

184

76075 ✓

120

8

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	PART NUMBER	DESCRIPTION
1	X			D2580-041	SKIDTUBE ASSEMBLY
2		X		D2580-045	SKIDTUBE ASSEMBLY
3			X	D2580-047	SKIDTUBE ASSEMBLY
4	1	1	1	D2500-1-190	EXTRUSION
5			16	D2570	BUSHING
6	1	1	1	D2576-3	STEP
7	20	24	25	D2579	SPACER
8	16	16	8	D2594-1	PLUG
9	16	16	8	D2594-3	O-RING
10	1	1	1	D2596	205 WEB
11	1	1	1	D2855	AFT CAP
12	1	1		D3564-5	WEARSHOE
13	1	1		D3564-9	WEARSHOE
14	1	1		D3564-11	WEARSHOE
15	1	1		D3564-13	WEARSHOE
16	2	2		D3566-1	GASKET
17	1	1		D3566-5	GASKET
18	1	1		D3566-13	GASKET
19			1	D4406-041	WEARPLATE ASSEMBLY
20			1	D4406-043	WEARPLATE ASSEMBLY
21	50	50		ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
22	50	50		AN3C4A	BOLT
23	2	2	2	AN3-5A	BOLT
24			8	AN4-45A	BOLT
25	50	50		NAS1149C0332R	WASHER (AN960C10L)
26	2	2	2	NAS1149D0332J	WASHER (AN960JD10L)
27			8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:

- MATERIAL: N/A
- FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY (-041/-047) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: NONE
- WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 37.7 lbs
- WELDING PER DART QSI 004.
- INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/291.
- INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047)
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

DEO ATTACHED

RELEASED

2011-08-29

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 78496 M.C.J

12/01/10

E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	140	DRAWING NO.	REV. E
MFG. APPR.	140	D2580	SHEET 1 OF 8
APPROVED	140	TITLE	SCALE
DE APPR.	140	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

78496

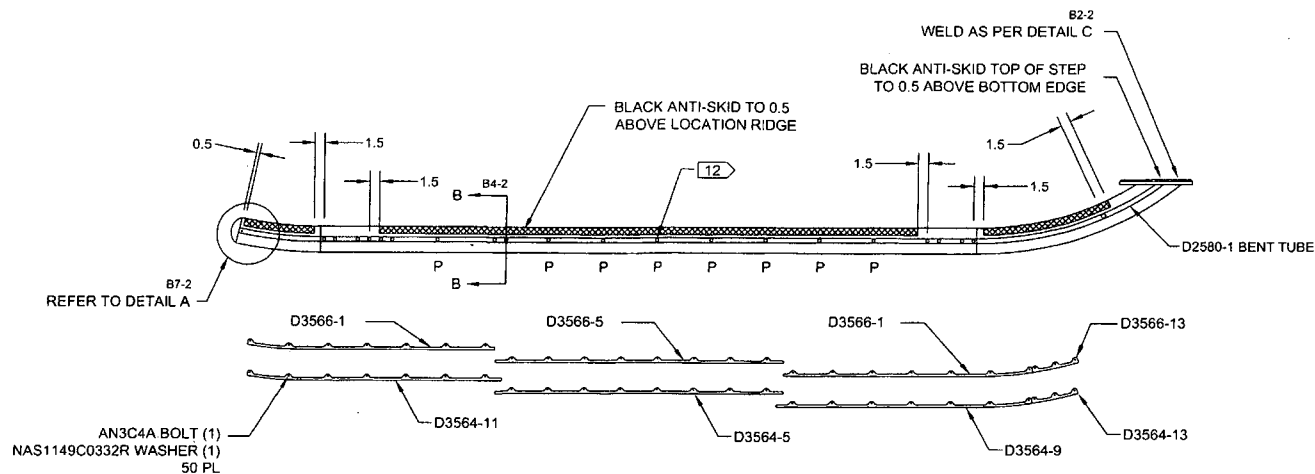


D2580-041 ASSEMBLY DETAIL

DETAIL A C7-2
SCALE 5X

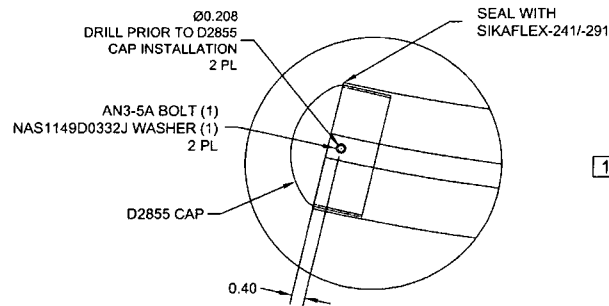


SECTION B-B D5-2
SCALE 5X

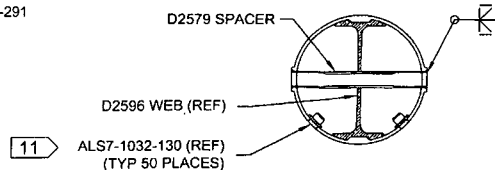

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2579 SPACER (20 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C-BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DETAIL C D3-2
SCALE 5X

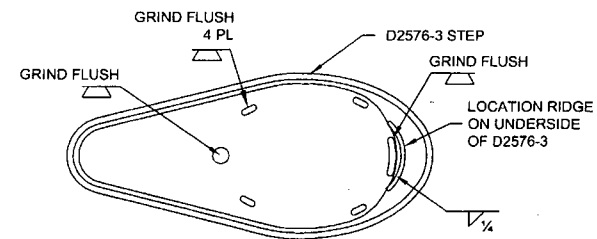

DEO ATTACHED

RELEASED
2011-08-29

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	140	DRAWING NO.	REV. E
MFG. APPR.	15	D2580	SHEET 2 OF 8
APPROVED	140	TITLE	SCALE
DE APPR.	140	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

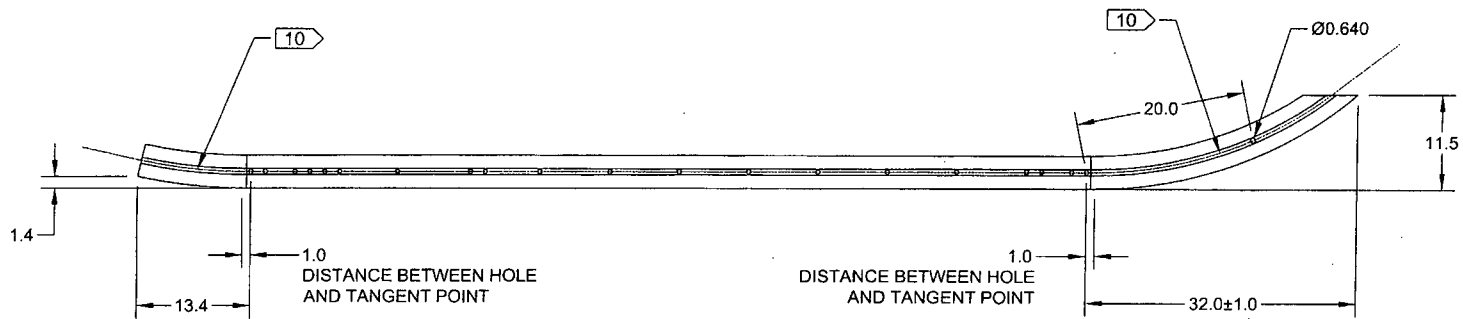

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED

RELEASED
2011-08-28

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D2580	SHEET 3 OF 8
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

70496

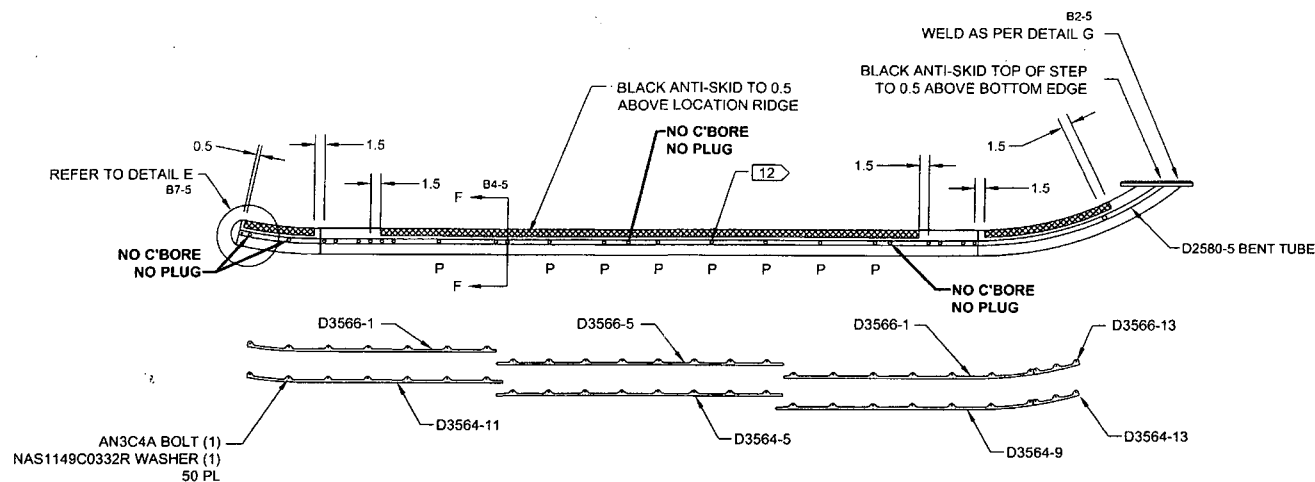


D2580-045 ASSEMBLY DETAIL


DEO ATTACHED

RELEASE
2011-08-29

DETAIL E D7-5
SCALE 5X

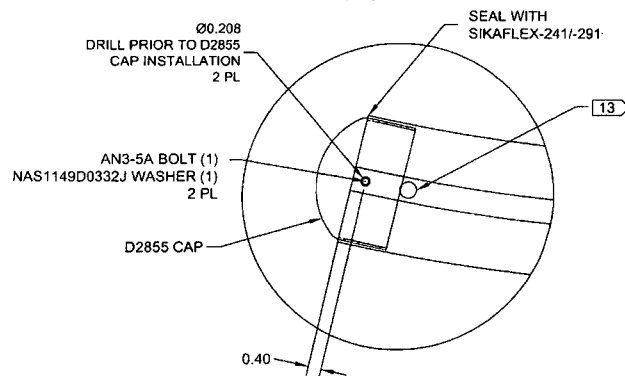


SECTION F-F D5-5
SCALE 5X

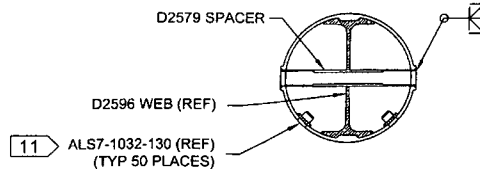

**AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:**

- 1. CHAMFER HOLE 0.050 X 45°**
- 2. INSERT D2579 SPACER (24 PLACES)**
- 3. WELD INTO PLACE AND GRIND FLUSH**
- 4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP**

DETAIL G D3-5
SCALE 5X

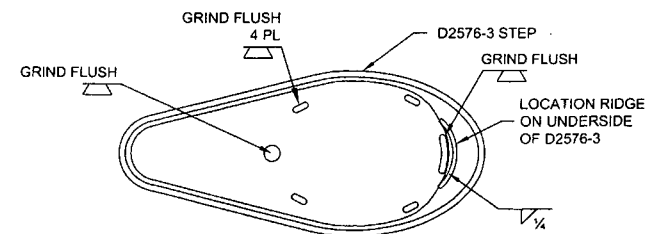

DESIGN	#	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D2580 TITLE 205 SKIDTUBE ASSEMBLY SCALE NTS
DRAWN	RF	
CHECKED	MP	
MFG. APPR.	MP	
APPROVED	MP	
DE APPR.	#	
DATE 11.06.21		

COPYRIGHT © 1996 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

78496

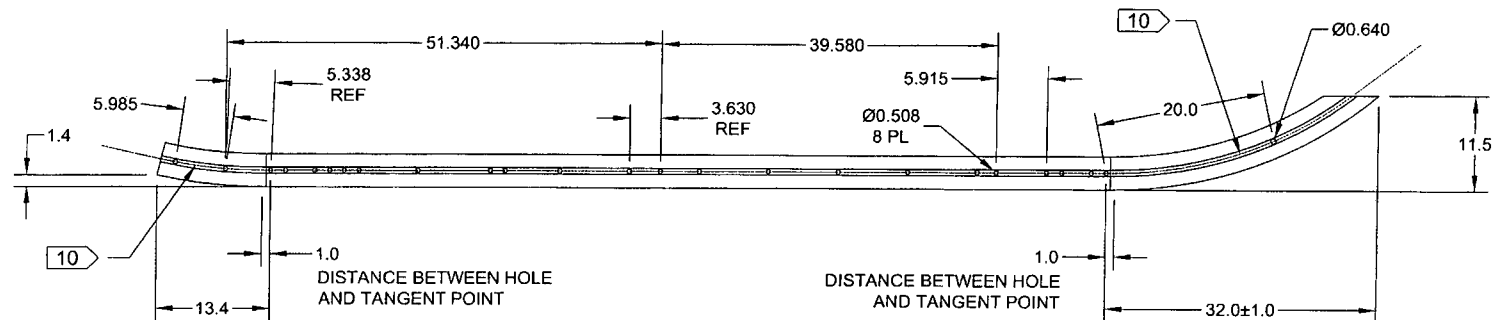

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

DEO ATTACHED

RELEASED

2011-08-29

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D2580	SHEET 5 OF 8
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

78496

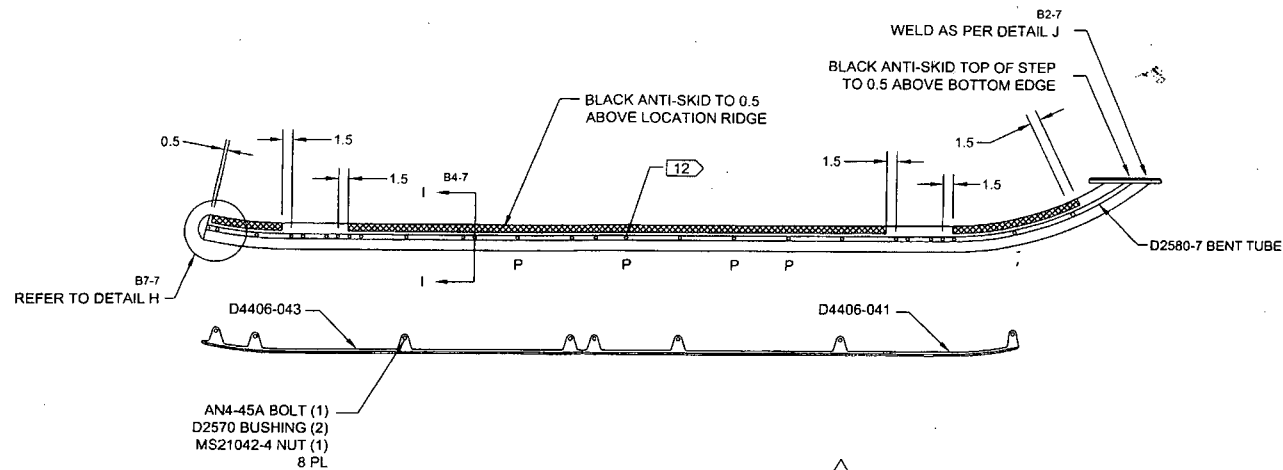


D2580-047 ASSEMBLY DETAIL E

DETAIL H C6-7
SCALE 5X

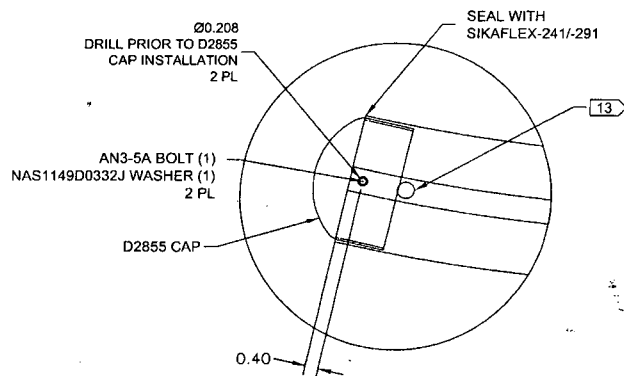


SECTION I-I D5-7
SCALE 5X

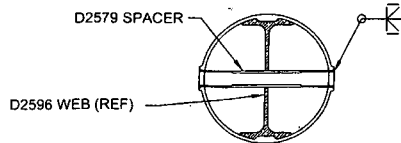

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (25 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DETAIL J D3-7
SCALE 5X

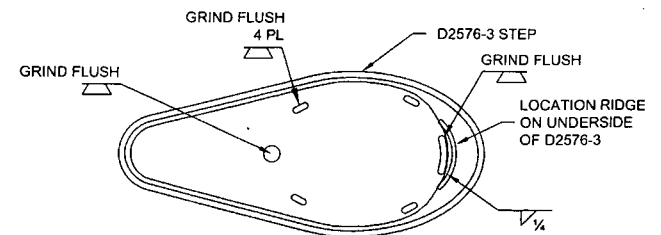

DESIGN	#	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	10	DRAWING NO.	REV. E
MFG. APPR.	10	D2580	SHEET 6 OF 8
APPROVED	10	TITLE	SCALE
DE APPR.	10	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

78496

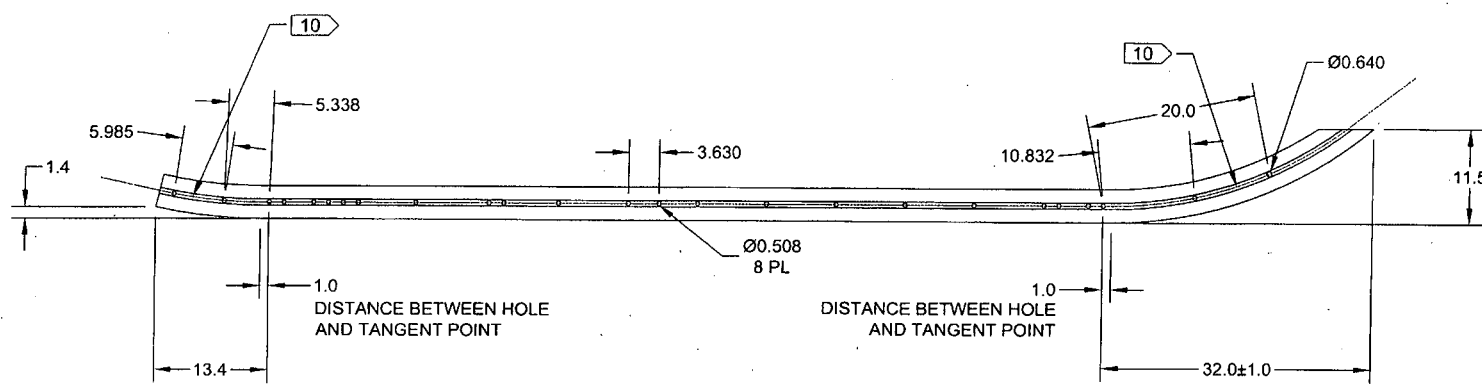

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)



DEO ATTACHED
RELEASED
2011-08-29
AW

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	RF	D2580	SHEET 7 OF 8
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	205 SKIDTUBE ASSEMBLY	NTS
DATE	11.06.21	<small>COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

78496

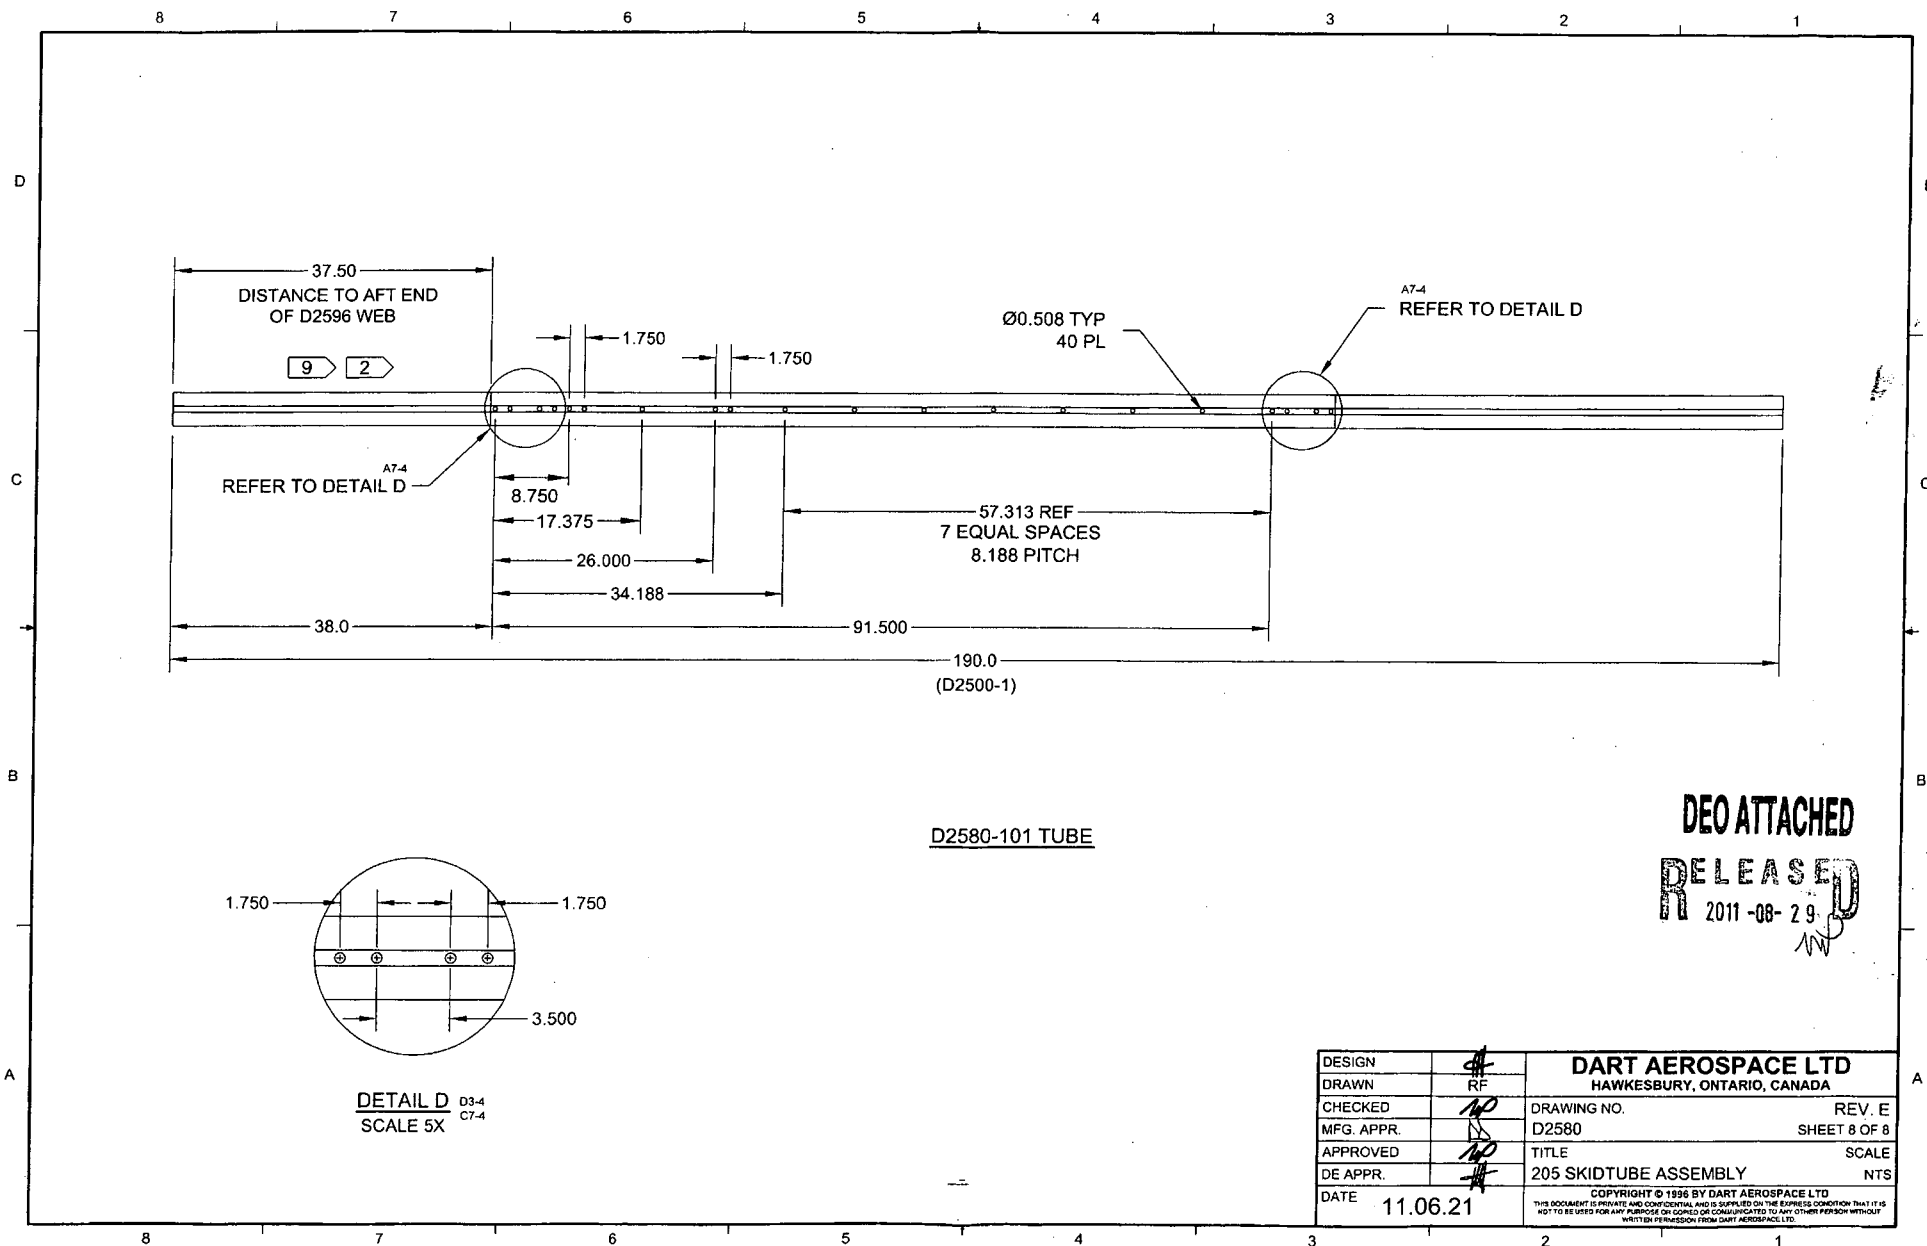

DEO ATTACHED
RELEASED
2011-08-29

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

78496

DRAWING NO. D2580	TITLE 205 SKIDTUBE ASSEMBLY	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D2580-E-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>ER</i>	APPROVED <i>[Signature]</i>	DE APPR. <i>[Signature]</i>		
DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	DATE 11.12.13	

PURPOSE:

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:


PARTS LIST IS AMENDED AS FOLLOWS:

WAS

QTY	QTY	QTY	PART NUMBER	DESCRIPTION
-041	-045	-047		
20	24	25	D2579	CROSS BOLT SPACER

IS

	4		* D2579	CROSS BOLT SPACER
20	20	25	D4202-1	SPACER

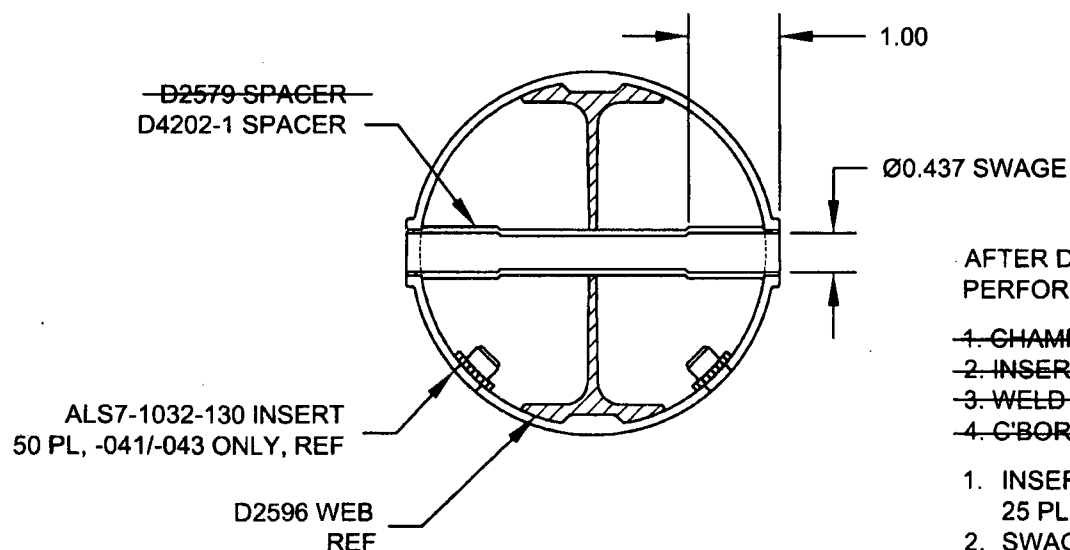SECTION B-B, SECTION F-F, & SECTION I-I ARE AMENDED AS FOLLOWS
FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:*** FOR -045 SKIDTUBE ONLY:**WELD 4X D2579 SPACERS PER DWG
IN LOCATIONS MARKED "NO C'BORE".
REF SHEET 4 OF DWG.RELEASED
2011-12-14 *[Signature]*AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

1. INSERT D4202-1 SPACER, 20 PL (-041) OR 20 PL (-045) OR 25 PL (-047)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

SECTION B-B, F-F, I-I
NOT TO SCALE

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 280

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 78496
Part number: A205-634-141
Description: SKID tube
Welding Process: Tig[☒] Mig[]
Base material: Alum
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier David David Date of Test Coupon 12.01.11
Welder Barclay Elliott Date of Test Coupon 12.01.11

The above named individual is qualified in accordance with AWS D17.1.2001 to weld